


E 3176



Gleitplatte wartungsfrei, mit Schraubenbohrungen

Self lubricating flat guiding stock, with screw holes

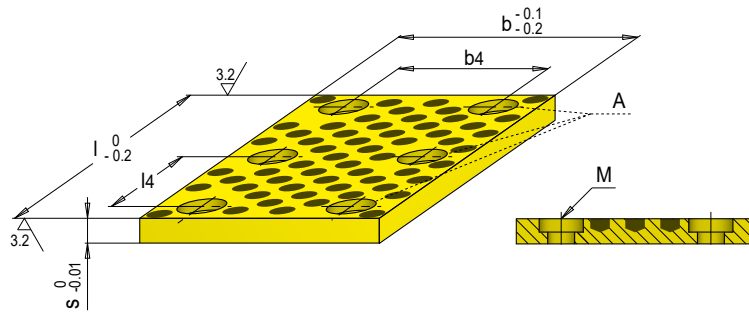

Mat.: 2.0598

≈ 180 HB / Graphit / graphite

0.8/

t max. = 200°C

M	A ¹⁾	b4 ²⁾	l4	b	s	l	Nr. / No.
M 4	2	-	14	12	5	25	E 3176/12/ 5/ 25
			16			32	E 3176/12/ 5/ 32
			24			40	E 3176/12/ 5/ 40
			34			50	E 3176/12/ 5/ 50
			47			63	E 3176/12/ 5/ 63
			32			80	E 3176/12/ 5/ 80
	3	-	40	16		100	E 3176/12/ 5/100
			16			32	E 3176/16/ 5/ 32
			24			40	E 3176/16/ 5/ 40
			34			50	E 3176/16/ 5/ 50
			47			63	E 3176/16/ 5/ 63
			32			80	E 3176/16/ 5/ 80
	2	-	42	20		100	E 3176/16/ 5/100
			24			32	E 3176/16/ 6/ 32
			30			40	E 3176/20/ 6/ 40
			43			50	E 3176/20/ 6/ 50
			60			63	E 3176/20/ 6/ 63
			40			80	E 3176/20/ 6/ 80
	3	-	50	25		100	E 3176/20/ 6/100
			16			125	E 3176/20/ 6/125
			20			32	E 3176/25/ 6/ 32
			26			40	E 3176/25/ 6/ 40
			39			50	E 3176/25/ 6/ 50
			56			63	E 3176/25/ 6/ 63
2	-	76	32	80	E 3176/25/ 6/ 80		
		100		E 3176/25/ 6/100			
		125		E 3176/25/ 6/125			
		160		E 3176/25/ 6/160			
		40		200	E 3176/32/ 6/ 40		
		50		250	E 3176/32/ 6/ 50		
3	-	63	40	63	E 3176/32/ 6/ 63		
		80		80	E 3176/32/ 6/ 80		
		100		100	E 3176/32/ 6/100		
		125		125	E 3176/32/ 6/125		
		160		160	E 3176/32/ 6/160		
		200		200	E 3176/32/ 6/200		
4	20	26	50	50	E 3176/40/ 6/ 50		
		39		63	E 3176/40/ 6/ 63		
		56		80	E 3176/40/ 6/ 80		
		76		100	E 3176/40/ 6/100		
		100		125	E 3176/40/ 6/125		
		125		160	E 3176/40/ 6/160		
6	-	160	63	200	E 3176/40/ 6/200		
		58		250	E 3176/50/ 8/ 250		
		39		80	E 3176/63/ 8/ 80		
		56		100	E 3176/63/ 8/100		
		76		125	E 3176/63/ 8/125		
		68		160	E 3176/63/ 8/160		
8	-	200	80	200	E 3176/63/ 8/200		
		250		250	E 3176/63/ 8/250		
		315		315	E 3176/63/ 8/315		
		100		100	E 3176/80/ 8/100		
		125		125	E 3176/80/ 8/125		
		160		160	E 3176/80/ 8/160		



M	A ¹⁾	b4 ²⁾	l4	b	s	l	Nr./ No.
M 6	8	50	58	80	8	200	E 3176/80/ 8/200
			72			250	E 3176/80/ 8/250
			93			315	E 3176/80/ 8/315

1) A: Anzahl Bohrungen / A: Number of holes

2) b4: " - " Bohrungen eine Reihe, mittig / b4: " - " screw holes on centre line

